



IR Text Comment Value	Label Value
Location Upstairs Large Elec Room	IR: Date Of Creation 06-12-05
Designation Pnl 220B	IR: File Name IR_120506_017.JPG
Component 100A Breaker	Ar1: Max 61.6 °C
Fault warm Line Side Connection	
Recommendations Remove brk, clean connection, re-install, re-scan	

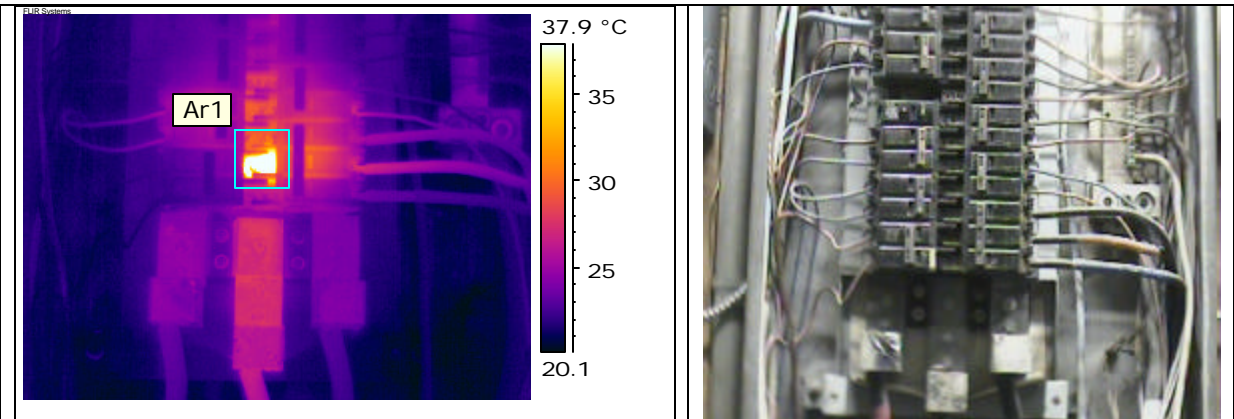

IR Text Comment Value	Label Value
Location Upstairs Large Elec Room	IR: Date Of Creation 06-12-05
Designation Panel 100	IR: File Name IR_120506_023.JPG
Component 15A Breakers	
Fault Overloaded Circuits	
Recommendations See comments below	

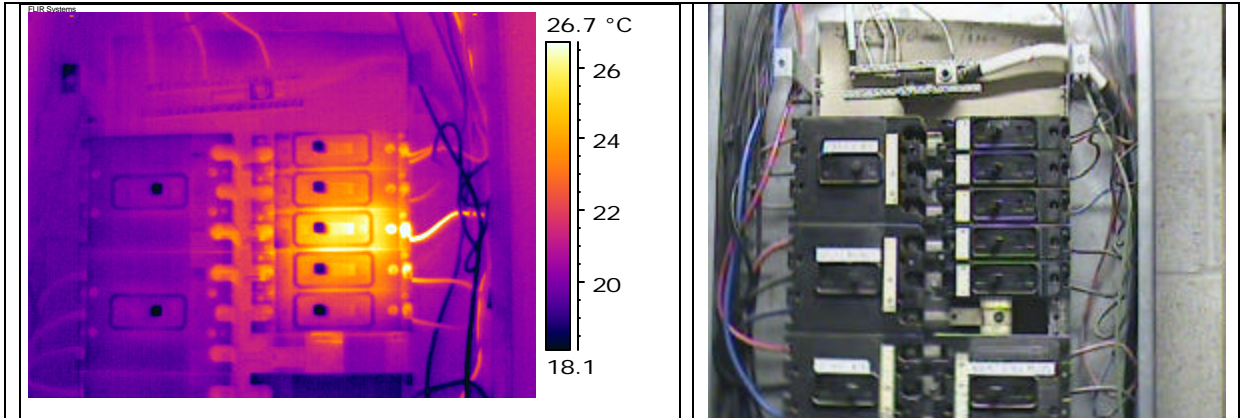

Comments:

Single pole 15amp breakers appear to be un-balanced. Couple of these single pole breakers have 18amps on them. The neutral conductor has 15amps on it. The top right breaker was in the tripped position when we found it.

Trace out circuits and re balance loads.